 
 


THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GROUND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.



 
THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OF HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GROUND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.




THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GRIND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER, FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.




THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE, HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GRIND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.




THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GRIND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.

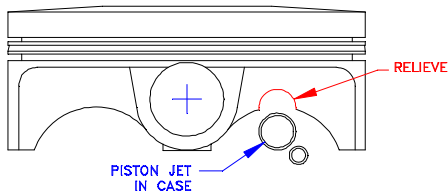


THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND JOE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GROUND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.

 


THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GRIND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.

 

THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GRIND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.

 

THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GRIND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.

 

THE CLEARANCE OF THE PISTON WEB TO THE OIL JET ON THE LEFT CASE HALF SHOULD ALWAYS BE CHECKED. THIS INCLUDES AFTERMARKET AND OE HONDA PISTONS AS THERE ARE SOME VARIATIONS IN FIT. IN MANY INSTALLATIONS A SMALL NOTCH MUST BE GRIND OR FILED IN THE PISTON WEB TO ALLOW CLEARANCE TO THE OIL JET. RECOMMENDED CLEARANCE IS 1.5 TO 2.0MM AT BOTTOM DEAD CENTER. FAILURE TO PROVIDE THIS CLEARANCE WILL RESULT IN ENGINE DAMAGE AND CATASTROPHIC FAILURE.

